

the initial or subsequent performance test;

(2) Maintaining the 3-hour average pH of the scrubber blowdown at a level no higher than 4.5 (if measured by a CPMS) or maintaining the pH level of the scrubber blowdown during each production shift no higher than 4.5;

(3) Inspecting and maintaining each CPMS according to the requirements of § 63.7741(e) and recording all information needed to document conformance with these requirements; and

(4) Collecting and reducing monitoring data for scrubbing liquid flow rate and scrubber blowdown pH according to the requirements of § 63.7741(f) and recording all information needed to document conformance with these requirements. If the pH level of the scrubber blowdown is measured by a probe and meter, you must demonstrate continuous compliance by maintaining records that document the date, time, and results of each sample taken for each production shift.

[69 FR 21923, Apr. 22, 2004, as amended at 73 FR 7222, Feb. 7, 2008]

§ 63.7744 How do I demonstrate continuous compliance with the work practice standards that apply to me?

(a) You must maintain records that document continuous compliance with the certification requirements in § 63.7700(b) or with the procedures in your scrap selection and inspection plan required in § 63.7700(c). Your records documenting compliance with the scrap selection and inspection plan must include a copy (kept onsite) of the procedures used by the scrap supplier for either removing accessible mercury switches or for purchasing automobile bodies that have had mercury switches removed, as applicable.

(b) You must keep records of the chemical composition of all catalyst binder formulations applied in each furan warm box mold or core making line at a new or existing iron and steel foundry to demonstrate continuous compliance with the requirements in § 63.7700(d).

(c) For a scrap preheater at an existing iron and steel foundry, you must operate and maintain each gas-fired preheater such that the flame directly

contacts the scrap charged to demonstrate continuous compliance with the requirement § 63.7700(e)(1). If you choose to meet the work practice standard in § 63.7700(e)(2), you must keep records to document that the scrap preheater charges only material that is subject to and in compliance with the scrap certification requirements in § 63.7700(b).

(d) For a scrap preheater at a new iron and steel foundry, you must keep records to document that each scrap preheater charges only material that is subject to and in compliance with the scrap certification requirements in § 63.7700(b) to demonstrate continuous compliance with the requirement in § 63.7700(f).

§ 63.7745 How do I demonstrate continuous compliance with the operation and maintenance requirements that apply to me?

(a) For each capture system and control device for an emissions source subject to an emissions limit in § 63.7690(a), you must demonstrate continuous compliance with the operation and maintenance requirements of § 63.7710 by:

(1) Making monthly inspections of capture systems and initiating corrective action according to § 63.7710(b)(1) and recording all information needed to document conformance with these requirements;

(2) Performing preventative maintenance for each control device according to the preventive maintenance plan required by § 63.7710(b)(3) and recording all information needed to document conformance with these requirements;

(3) Operating and maintaining each bag leak detection system according to the site-specific monitoring plan required by § 63.7710(b)(4) and recording all information needed to demonstrate conformance with these requirements;

(4) Initiating and completing corrective action for a bag leak detection system alarm according to the corrective action plan required by § 63.7710(b)(5) and recording all information needed to document conformance with these requirements; and

(5) Igniting gases from mold vents according to the procedures in the plan